


Model **451.3/4**
 with code 527 (High-Line radio)
 except code 516 (RADIO WITH USB INTERFACE)
 except code C50 (smart radio ten)
 except code C57 (smart radio nine)
 except code P02 (car2go)

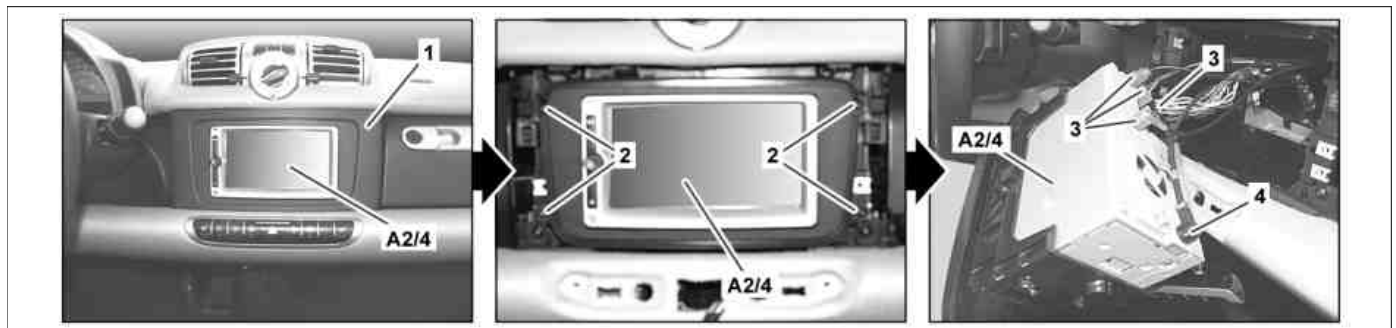

P82.60-9124-07

- | | |
|-----------------------------------------------------------------------------------|-----------------------------------------------------------------|
| <p>1 Cover</p> <p>2 Bolts</p> <p>3 Electrical connectors</p> | <p>4 Antenna plug</p> <p>A2/4 smart Premium radio</p> |
|-----------------------------------------------------------------------------------|-----------------------------------------------------------------|

❏ ❏	Remove/install		
1 	Have radio code ready for subsequent commissioning Service Information: Safety code as theft protection		SI82.60-P-0001A
2	Remove cover on center console		AR68.20-P-2350MCF
3	Remove screws/bolts (2) from Premium smart radio (A2/4)		
4	Pull Premium smart radio (A2/4) far enough out of radio recess until electrical connectors (3) and antenna plug (4) are accessible		
5	Disconnect electrical connectors (3) and antenna plug (4) from Premium smart radio 4 (A2)		
6	Remove Premium smart radio (A2/4)		
7	Install in the reverse order		
8 	Connect STAR DIAGNOSIS and read out fault memory		AD00.00-P-2000-04MCC
9	Enter radio code		
10 	Adapt audio settings Notes on audio settings		AH82.60-P-0002-01MCC
11	Perform function test of Premium smart radio (A2/4)		
12 	Check software release and update if necessary Service Information: Update audio equipment software		SI82.85-P-0003A
13	Enter serial number of Premium smart radio (A2/4) into vehicle documentation (VeDoc)	Perform software update for audio units When replacing Premium smart radio (A2/4). Enter serial number of Premium smart radio (A2/4) into theft-relevant data.	AR82.00-P-0500MCC